
patient commission/configuration ID \_\_\_\_\_\_





Item	14mm	Description	Potential Problem	Measure	Recommended Inspection, Potential Replacement*	Latest Replacement after
Syste	m Joint					
1	SB8559-L0630	bearing nut	wear	replacing	every 6 months	36 months
3	SF0392-02	feather key with pin	breakage	replacing	every 6 months	36 months
4	GS2009-040	sliding washer, Ø = 20mm	wear	replacing		18 months
4	GS2009-045					
4	GS2009-050				every 6 months	
4	GS2009-055					
4	GS2009-060					
5	SH0462-L/AL	cover plate, left lateral or right medial**	wear	replacing		36 months
5	SH0462-R/AL	cover plate, left medial or right lateral**			every 6 months	
6a	VE3771-08/15	O-ring for securing the alignment screw**	wear	replacing	every 6 months	18 months
6c	FE1916-01	pressure spring**	wear	replacing	every 6 months	18 months
6d	GS1007-350	sliding bushing**	wear	replacing	every 6 months	18 months
6e	VE3771-010/20	O-ring damper**	wear	replacing	every 6 months	18 months
6f	SH0492-01	plunger**	wear	replacing	every 6 months	36 months
7a	VE3771-09/15	O-ring for securing the alignment screw**	wear	replacing	every 6 months	18 months
7c	VE3771-04/10	O-ring for securing the motion limiting screw**	wear	replacing	every 6 months	18 months
8	SC1405-L11	countersunk flat head screw with hexalobular socket**	wear	replacing	every 6 months	36 months
9	SC1405-L11	countersunk flat head screw with hexalobular socket (axle screw)**				
5-9	SH4972-L/AL	functional unit plug + go modularity, left lateral or right medial***	loss of function, wear	replacing	avenu C manutha	36 months
5-9	SH4972-R/AL	functional unit plug + go modularity, left medial or right lateral***			every 6 months	

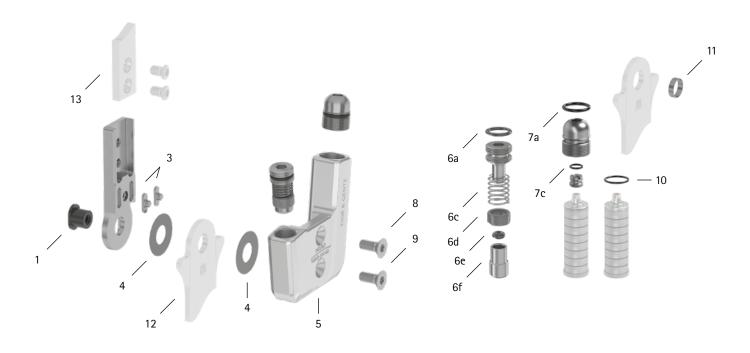

patient commission/configuration ID \_\_\_\_\_



Item	14mm	Description	Potential Problem	Measure	Recommended Inspection, Potential Replacement*	Latest Replacement after					
Spring Units											
10	VE3771-07/10	O-ring for securing the spring unit	wear	replacing	every 6 months	18 months					
-	SF5802-15/05	spring unit, blue, normal, max. 15° range of motion	wear radial move of disc springs noise of spring unit with coil spring noise of spring unit with disc springs	replacing realigning disc springs	every 6 months	18 months					
-	SF5802-15/11	spring unit, green, medium, max. 15° range of motion		with pliers greasing the coil spring with orthosis joint grease or spray oil (article no. FT3000-15) greasing disc springs laterally with spray oil (article no.: FT3000-15)							
-	SF5802-09/16	spring unit, white, strong, max. 10° range of motion									
-	SF5802-10/29	spring unit, yellow, very strong, max. 10° range of motion									
-	SF5802-05/53	spring unit, red, extra strong, max. 5° range of motion									
System Stirrups, System Anchors and System Side Bars											
11	BR1009-L025	sliding bushing	wear	replacing	every 6 months	18 months					
12	see catalogue	system stirrup	wear or breakage	replacing	every 6 months	48 months					
13	see catalogue	system anchor and system side bar	wear or breakage	replacing	every 6 months	if required					

<sup>\*</sup> depending on the assessment of the distributor of the custom-made product regarding the patient's usage behaviour

<sup>\*\*</sup> is part of the functional unit
\*\*\* included system components can be exchanged separately